



MANHOLE NUMBER	REQUIRED REHABILITATION/REPLACEMENT
MH 05A-0056.0	CHIMNEY SEAL <i>Delete Recast</i>
MH 05A-3759.0	NO REHABILITATION
MH 05A-2029.0	CHIMNEY SEAL <i>Total Rehab</i>
MH 05A-2030.0	ABANDON MANHOLE SEE DETAIL S-18 ON SHEET G-3
MH 05A-2031.0	REMOVE EXISTING MANHOLE AND INSTALL NEW 5.0' MANHOLE (FLUSH WITH PAVEMENT)
MH 05A-2032.0	ABANDON MANHOLE SEE DETAIL S-16 ON SHEET G-3

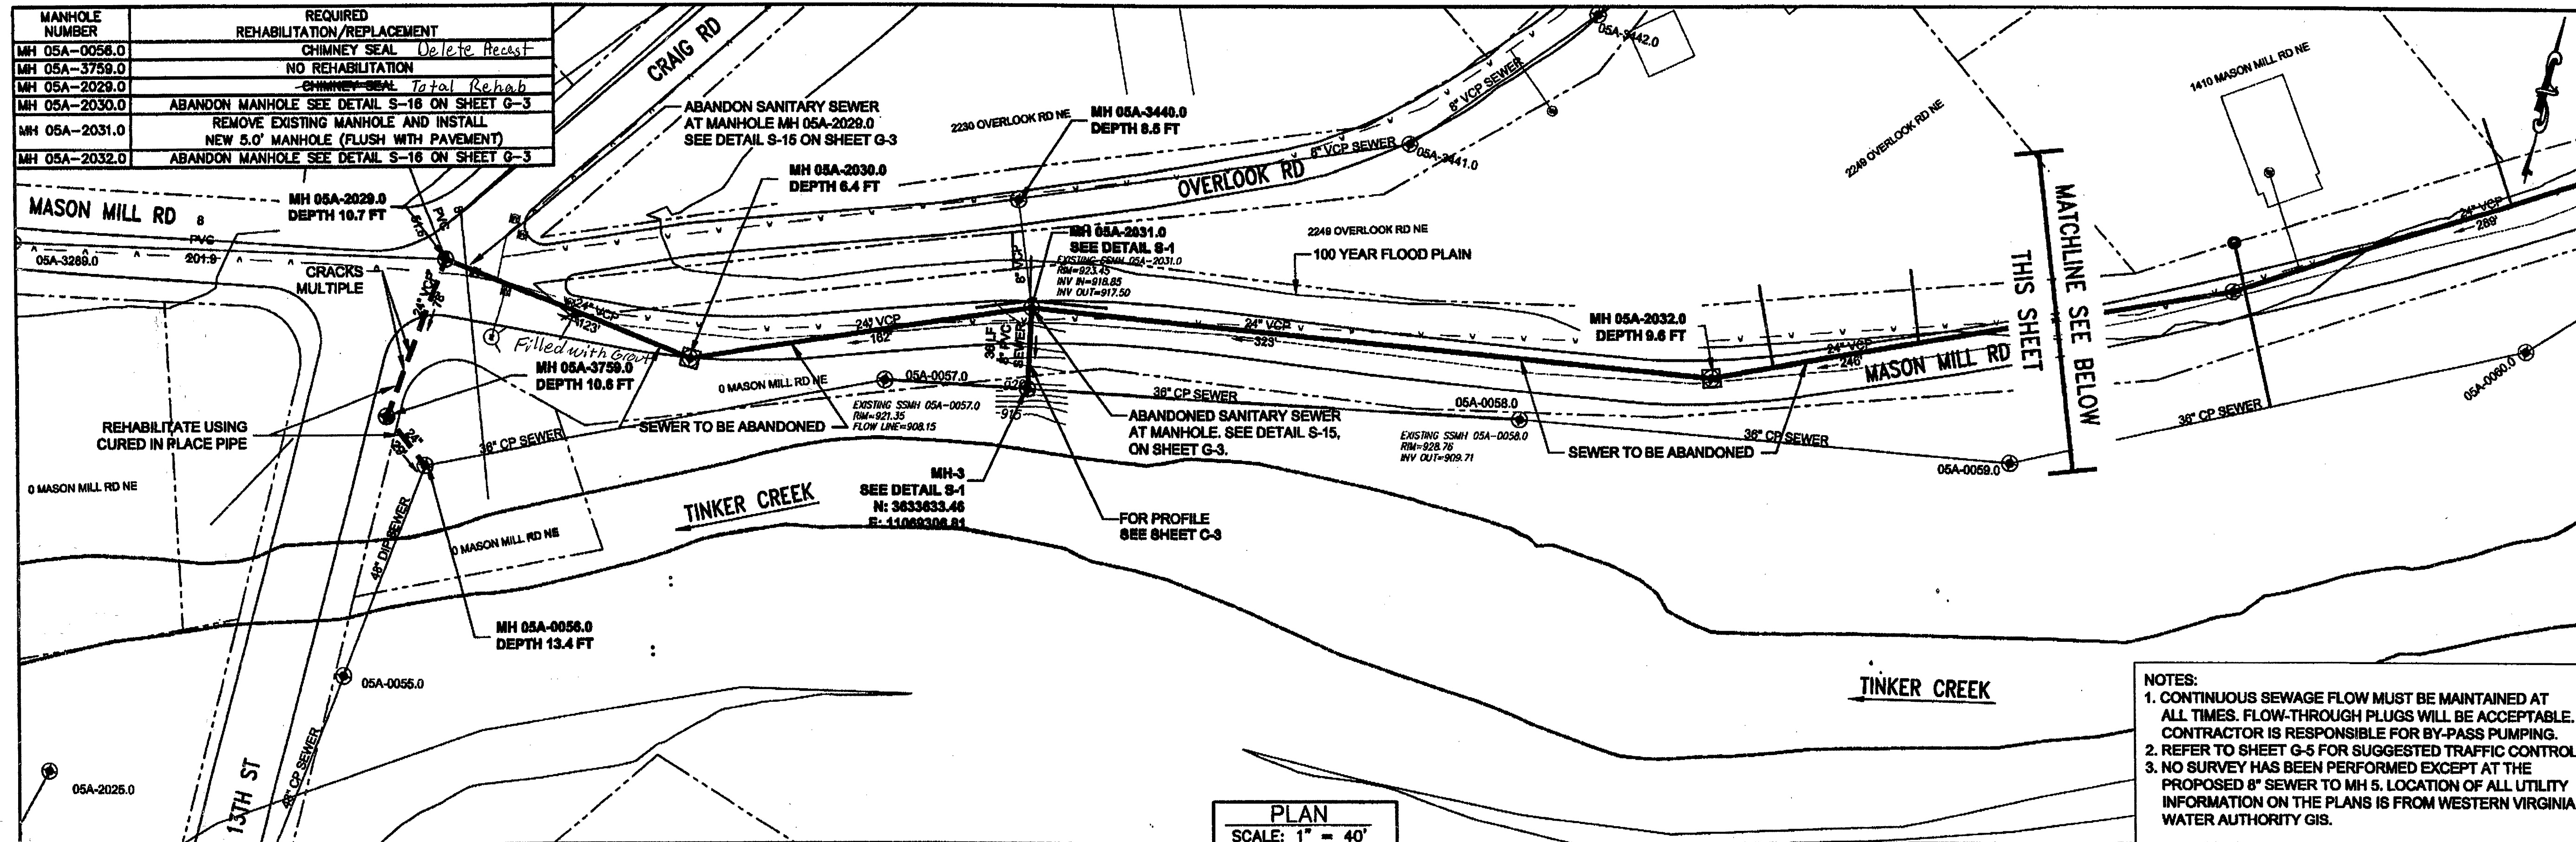

MANHOLE NUMBER	REQUIRED REHABILITATION/REPLACEMENT
MH 05A-2033.0	ABANDON MANHOLE SEE DETAIL S-16 ON SHEET G-3
MH 05A-2034.0	ABANDON MANHOLE SEE DETAIL S-16 ON SHEET G-3
MH 05A-2035.0	ABANDON MANHOLE SEE DETAIL S-16 ON SHEET G-3
MH 05A-2036.0	ABANDON MANHOLE SEE DETAIL S-16 ON SHEET G-3

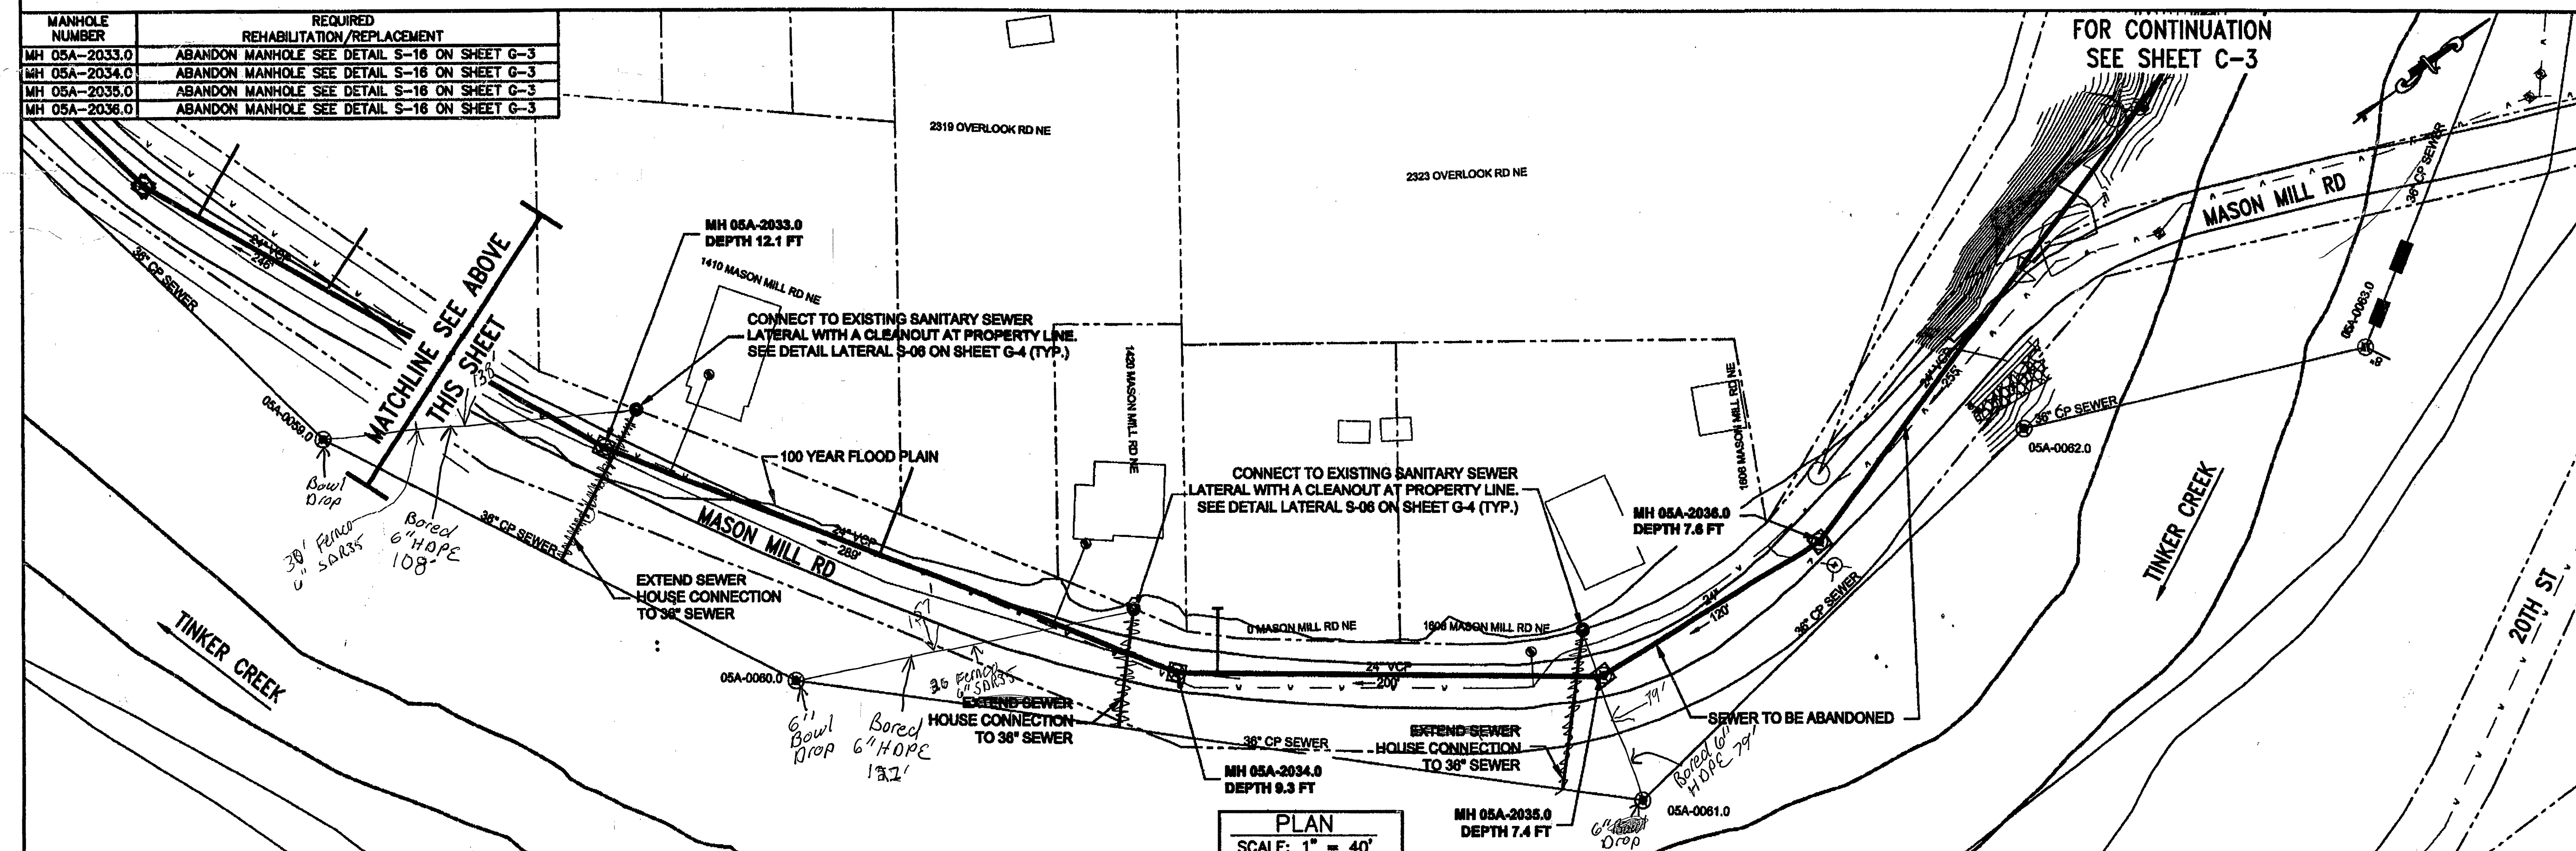

NOTES:

1. CONTINUOUS SEWAGE FLOW MUST BE MAINTAINED AT ALL TIMES. FLOW-THROUGH PLUGS WILL BE ACCEPTABLE. CONTRACTOR IS RESPONSIBLE FOR BY-PASS PUMPING.
2. REFER TO SHEET G-5 FOR SUGGESTED TRAFFIC CONTROL.
3. NO SURVEY HAS BEEN PERFORMED EXCEPT AT THE PROPOSED 8" SEWER TO MH 5. LOCATION OF ALL UTILITY INFORMATION ON THE PLANS IS FROM WESTERN VIRGINIA WATER AUTHORITY GIS.

FOR CONTINUATION
SEE SHEET C-3

PLAN
SCALE: 1" = 40'

TURN


**4905 DICKENS ROAD, SUITE 106
RICHMOND, VIRGINIA 23230
804/965-9000 www.URScorp.com**



**WESTERN VIRGINIA
WATER AUTHORITY**

**HOLLINS ROAD EASEMENT AND MASON MILL ROAD
SEWER REHABILITATION**

MASON MILL ROAD

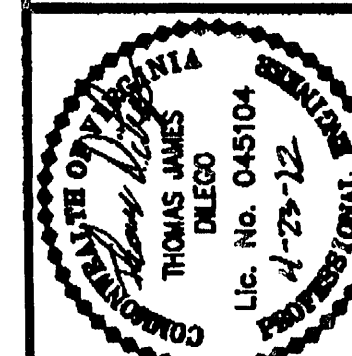

DATE: APRIL 20
JOB NO.: 116580
LEAD ENGINEER:
DRAWN BY:
CHECKED:
REVISION:

C-2

SHEET 8 OF 11