



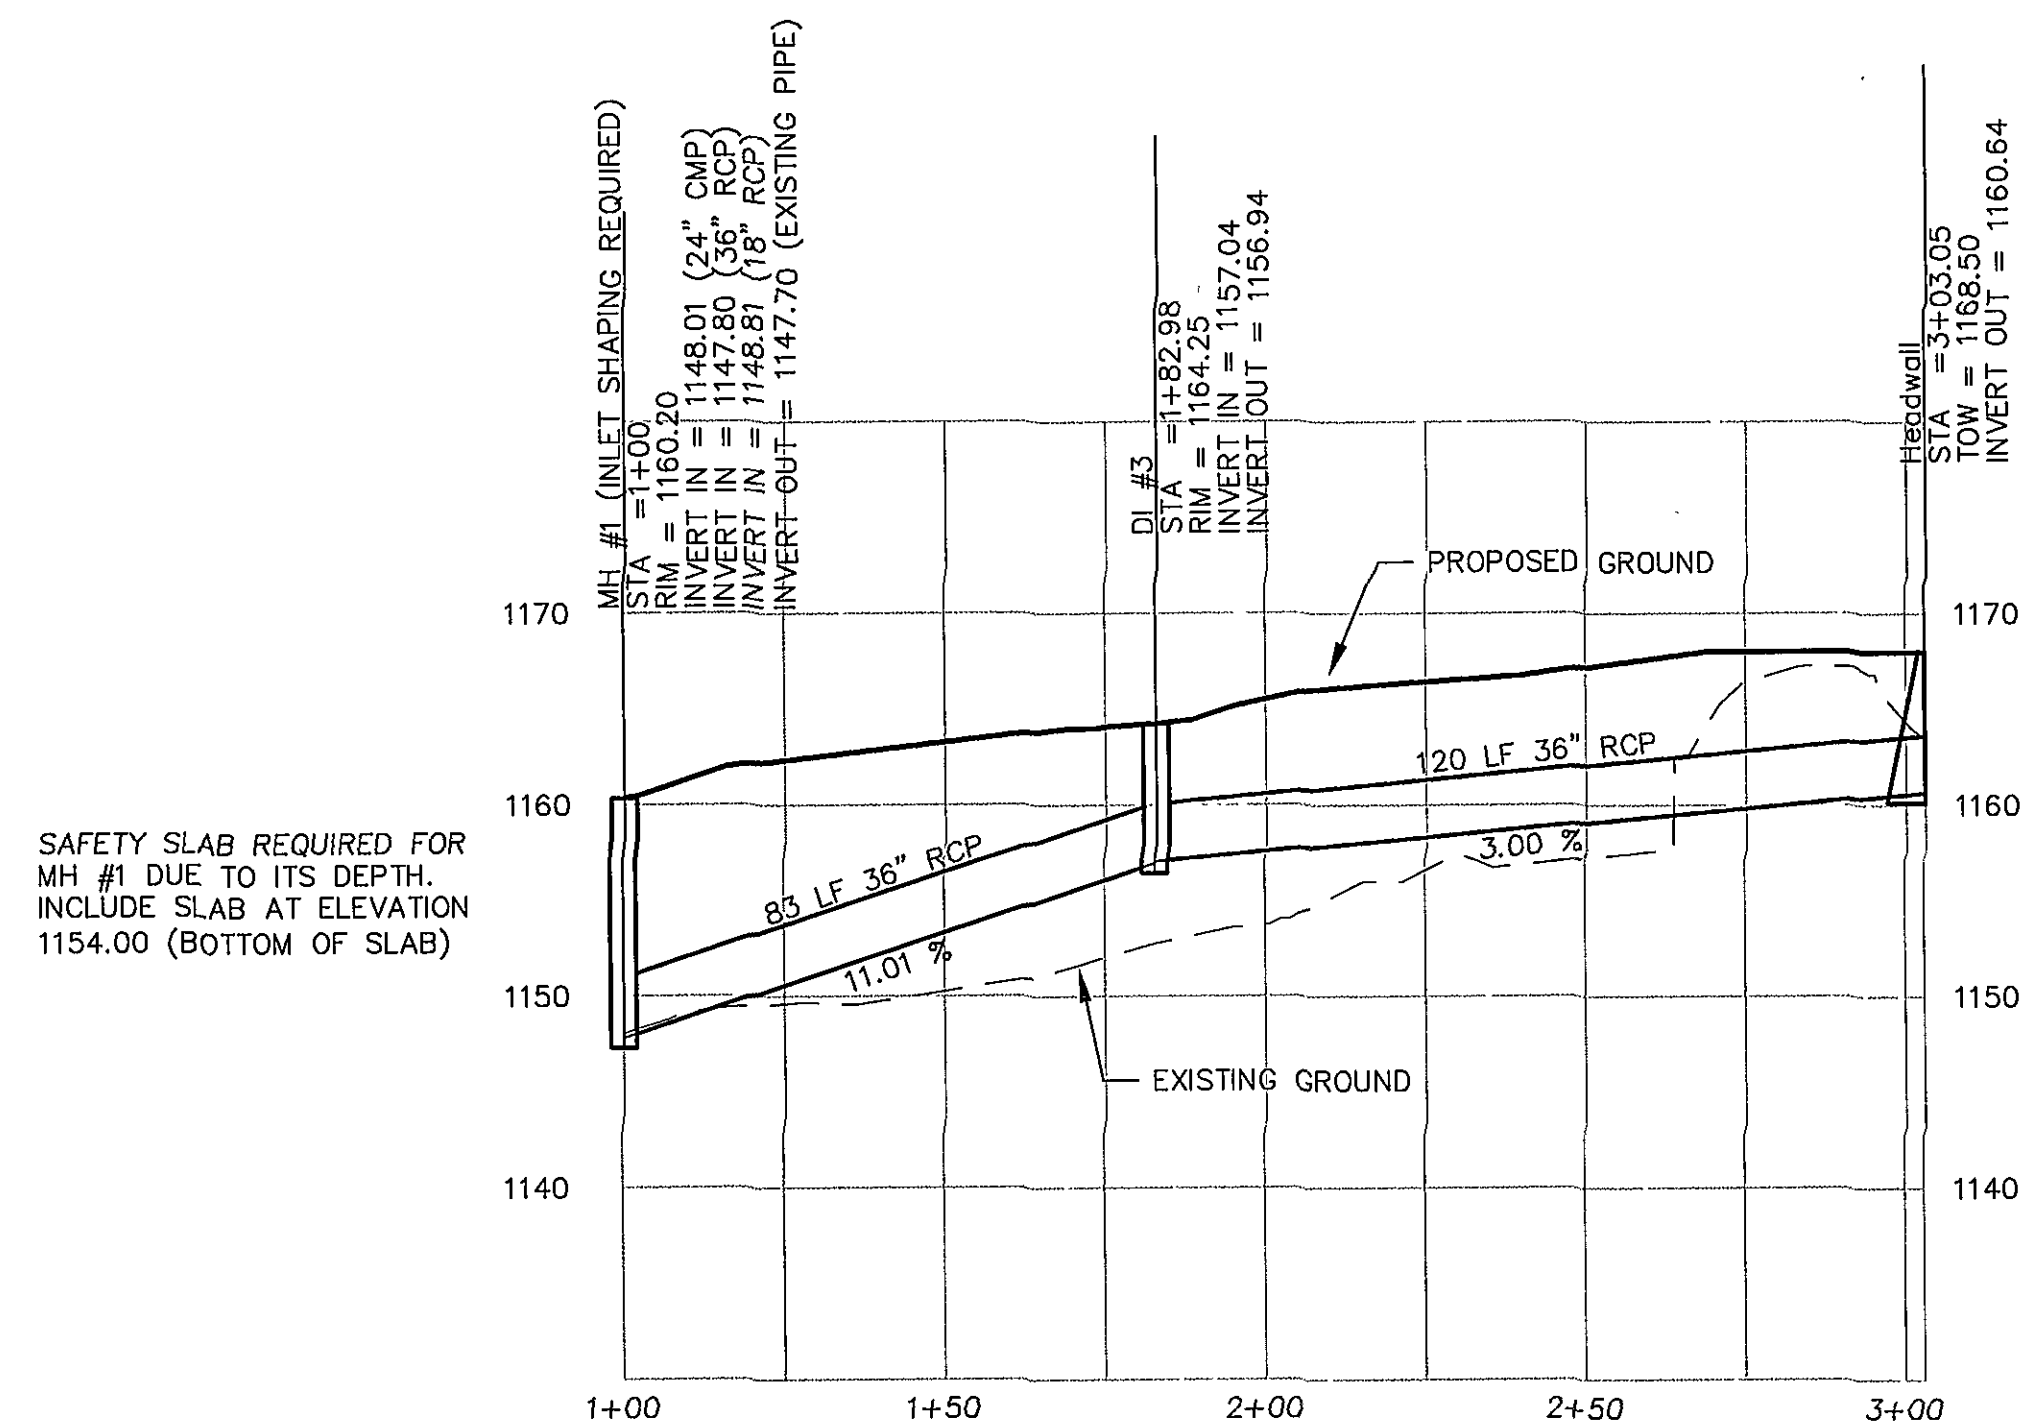


STORM LINE A PROFILE

NOTE: DISTANCES SHOWN ON
PROFILE ARE TO THE CENTERS
OF THE STRUCTURES AND ARE
NOT LENGTH OF PIPE.

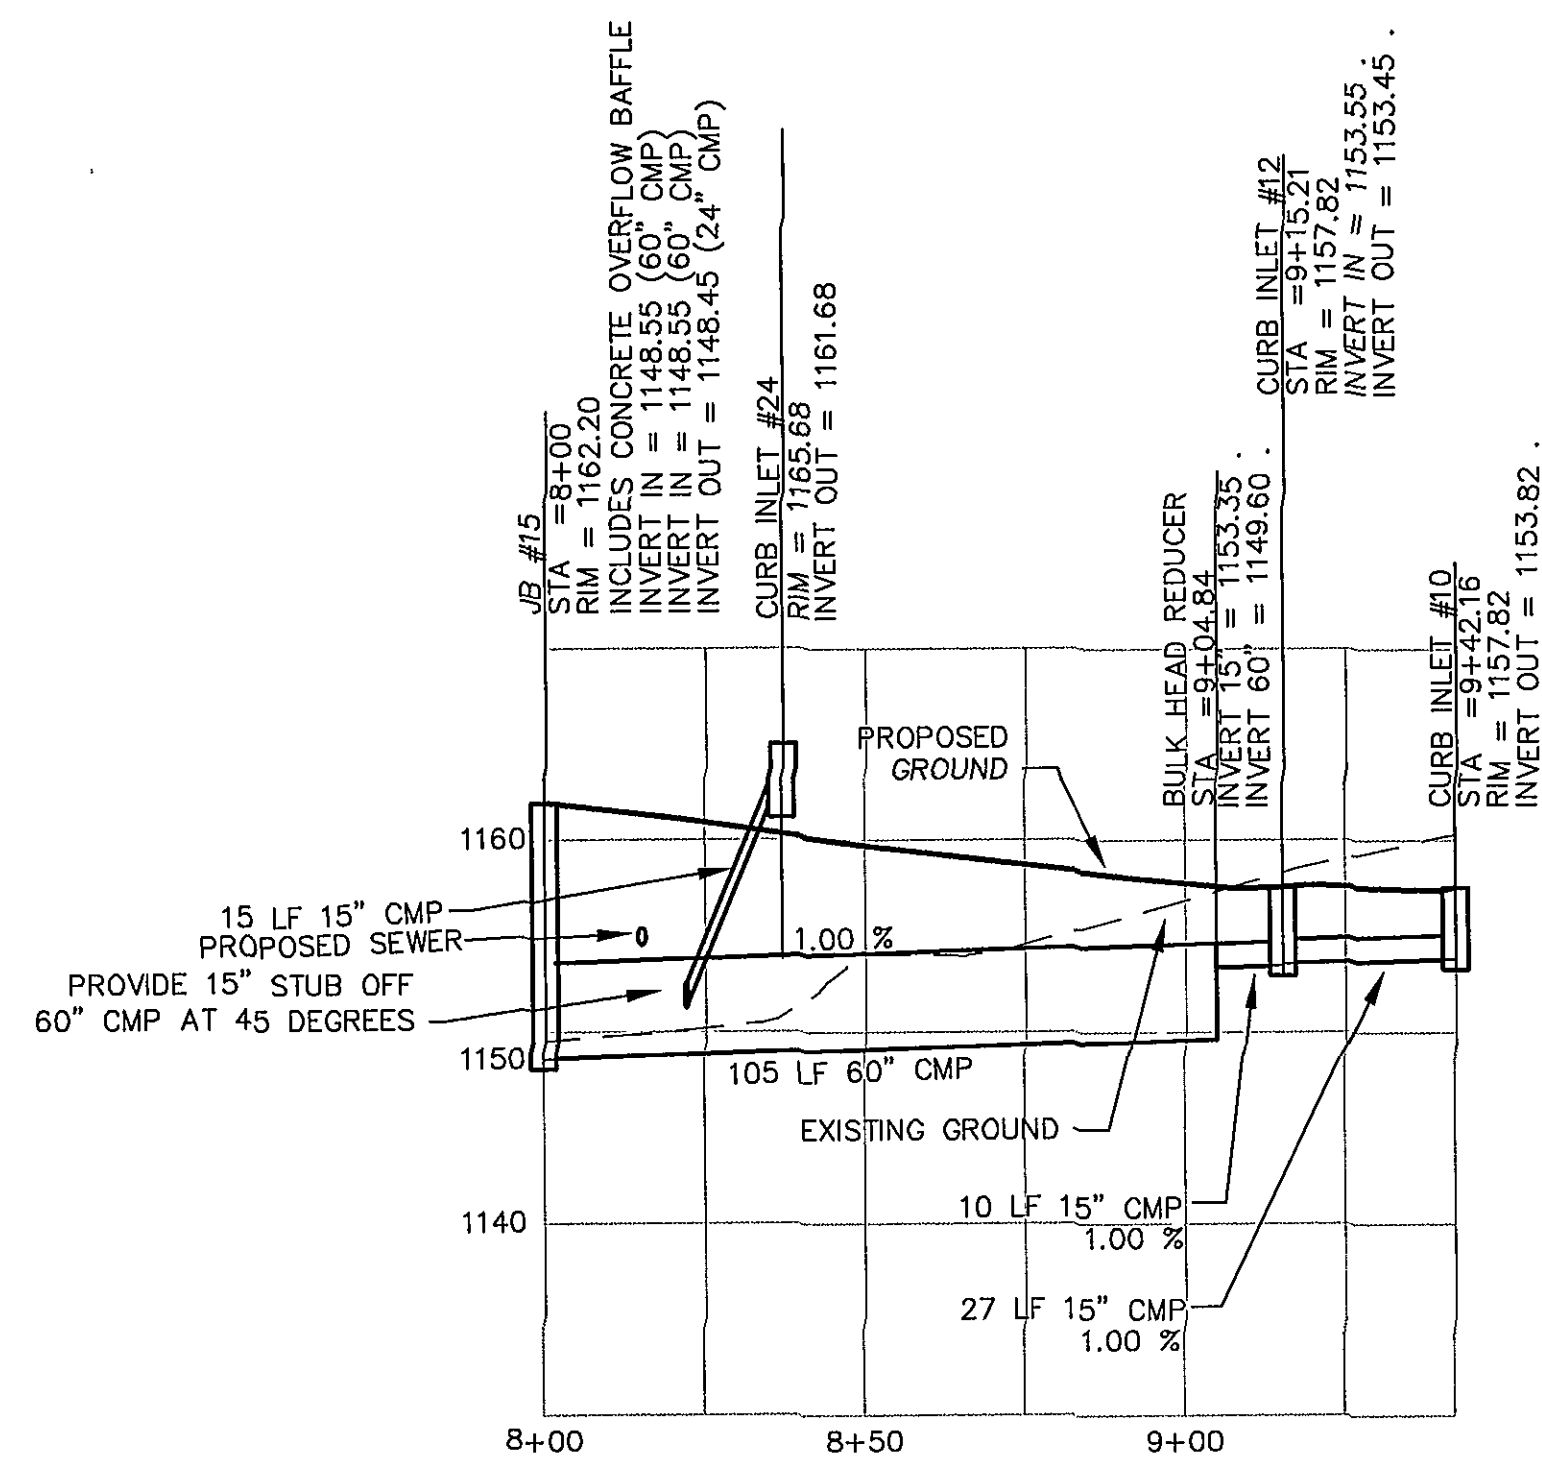


STORM LINE C PROFILE

NOTE: DISTANCES SHOWN ON
PROFILE ARE TO THE CENTERS
OF THE STRUCTURES AND ARE
NOT LENGTH OF PIPE.

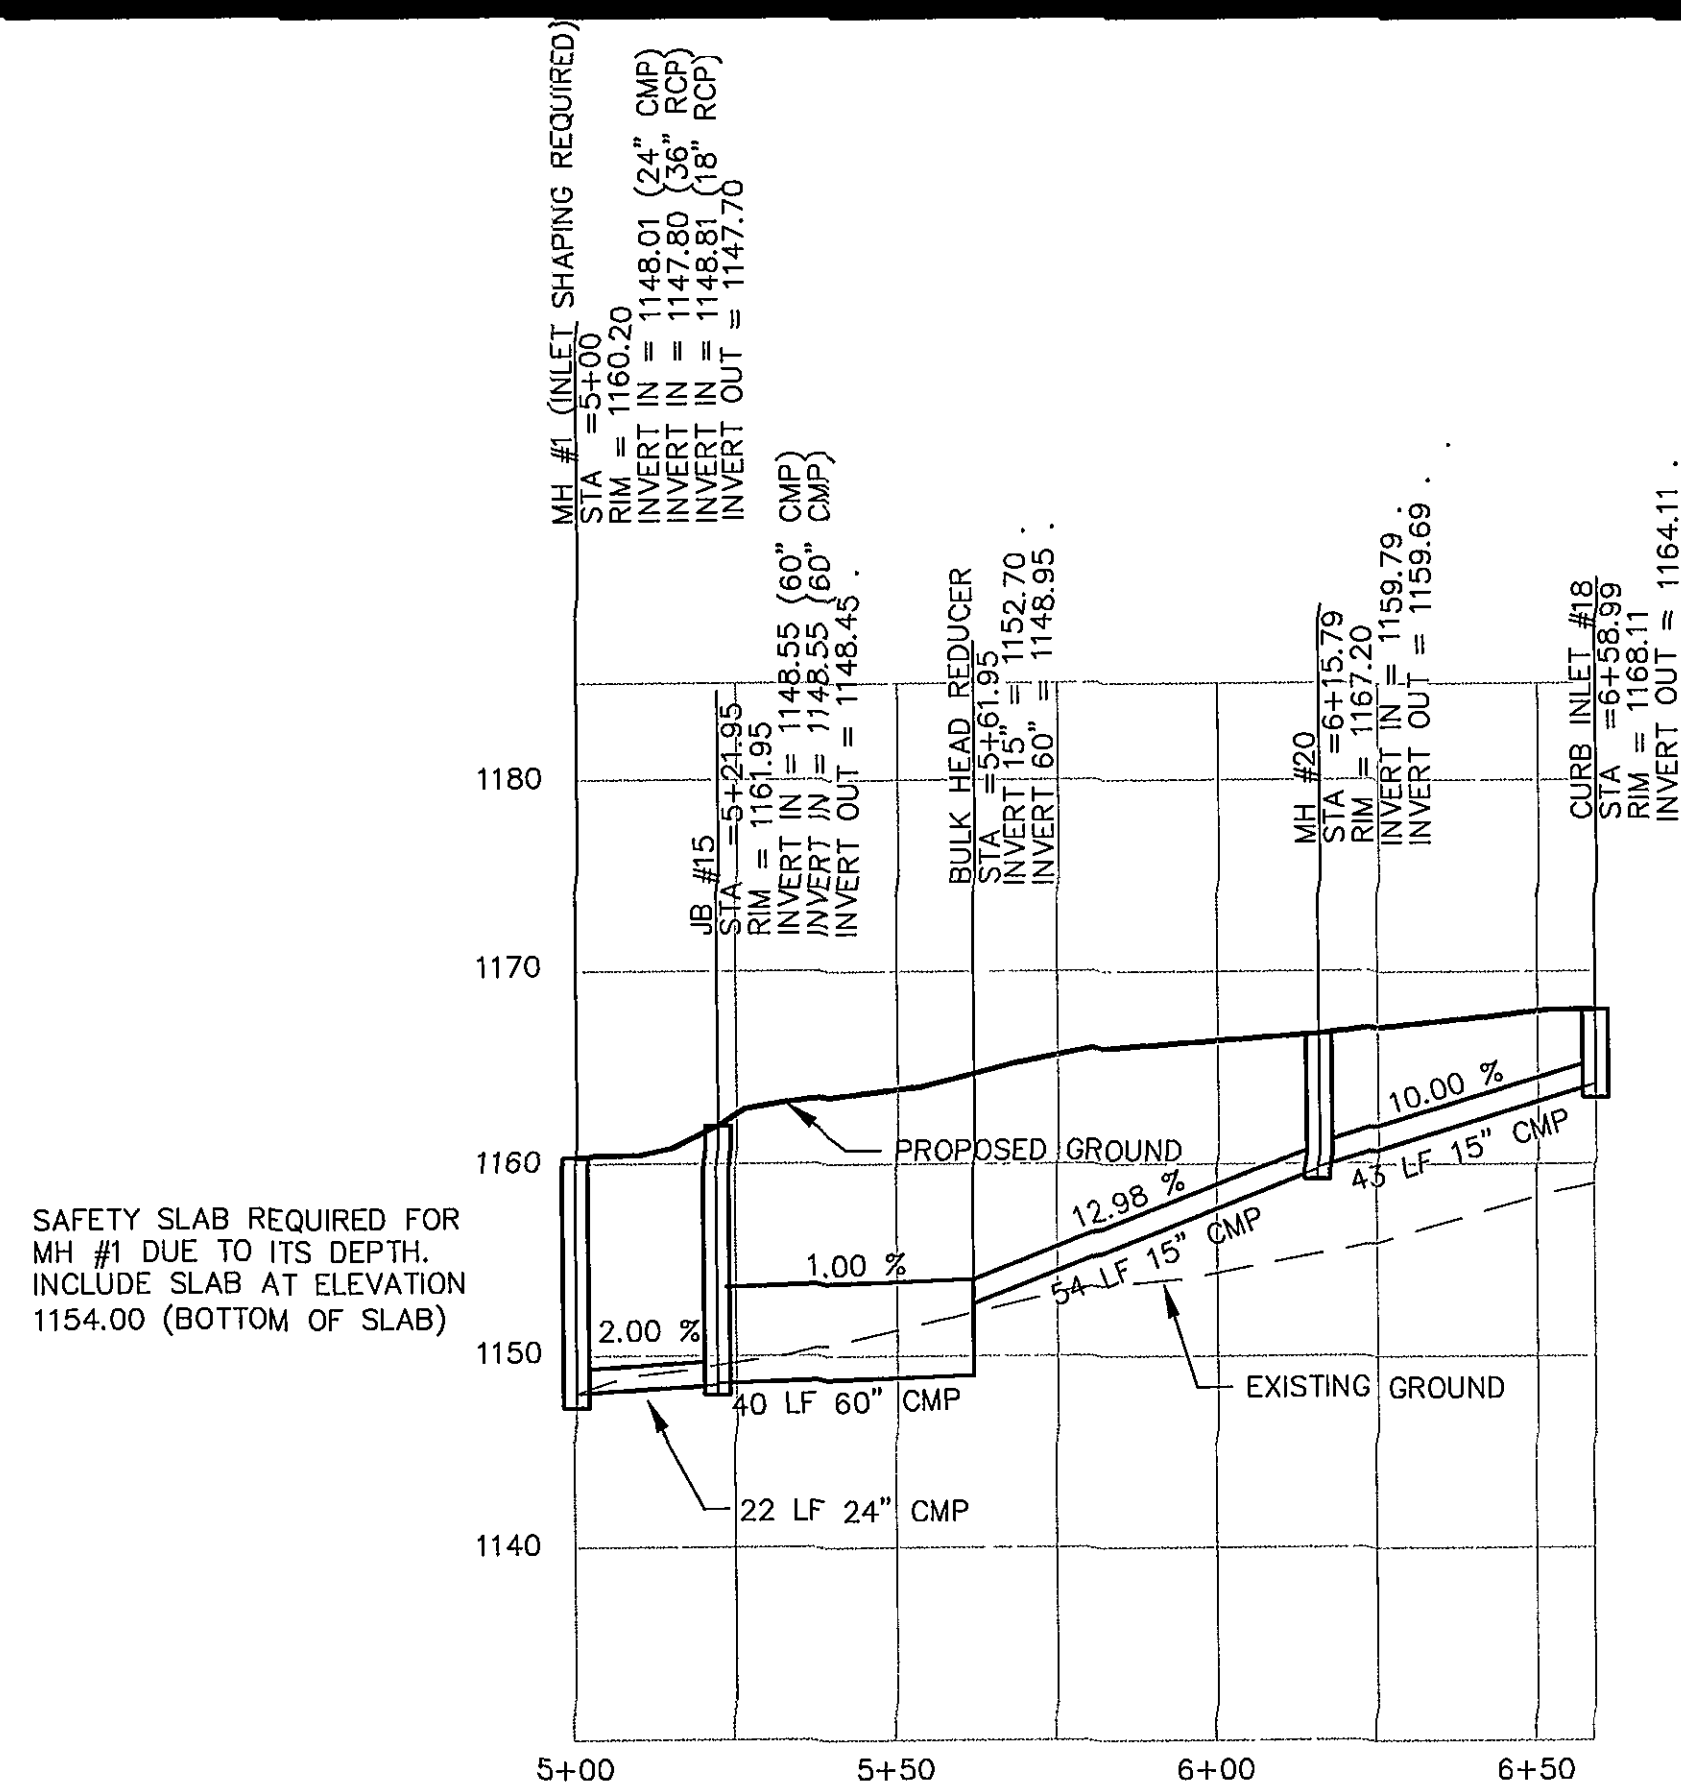


STORM LINE B PROFILE

NOTE: DISTANCES SHOWN ON
PROFILE ARE TO THE CENTERS
OF THE STRUCTURES AND ARE
NOT LENGTH OF PIPE.

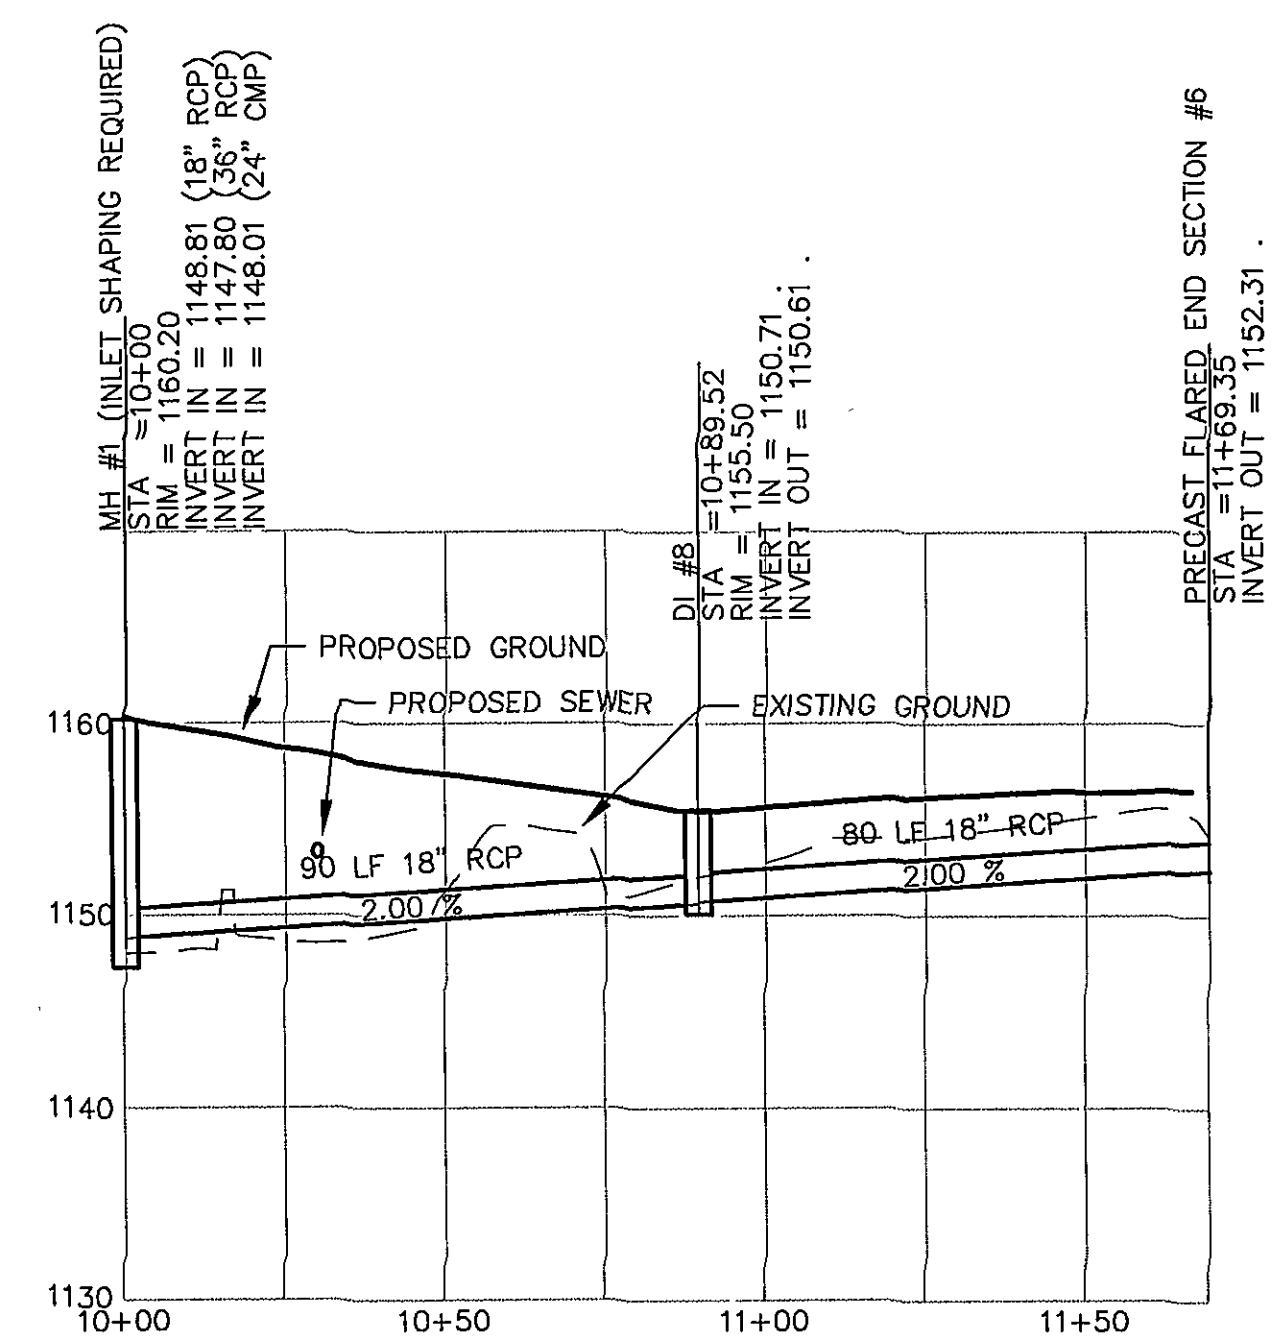


STORM LINE D PROFILE

NOTE: DISTANCES SHOWN ON
PROFILE ARE TO THE CENTERS
OF THE STRUCTURES AND ARE
NOT LENGTH OF PIPE.

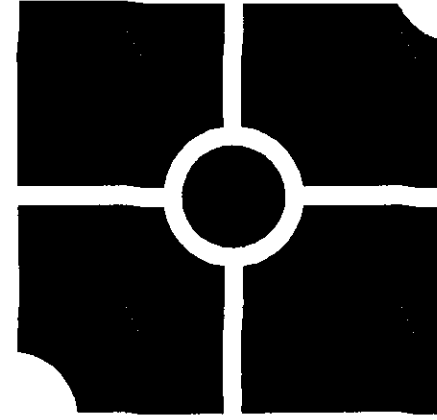

■ Barnes Grogan Bower & Taylor ■
DESIGN GROUP, PC
LANDSCAPE ARCHITECTS • ENGINEERS • PLANNERS
201 E. Main Street
Suite 100
Salem, Virginia 24153
Phone: 540.387.9100
Fax: 540.387.910
www.bgbt-design.com

These documents are the property of Barnes Grogan Bower & Taylor DESIGN GROUP (BGBT) and may not be reproduced or used without the express permission of BGBT. Any reuse of these documents without authorization of BGBT will be at the sole risk of the individual or entity utilizing said documents.

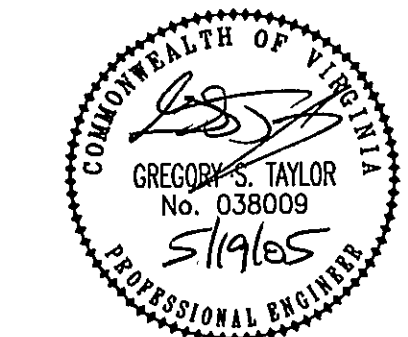

Member One Federal Credit Union
Route 419, Roanoke County
Prepared for Thor, inc.
Windsor Hills Magisterial District
Roanoke County, Virginia

REVISIONS:

County & VDOT Comment	March 29, 200
County, VDOT, & WVWA Comment	May 3, 200
County Comment	May 19, 200

DESIGNED BY: GST

DRAWN BY: GST

CHECKED BY: _____ **SRE**

SCALE: As Noted

DATE: November 16, 2004

SHEET TITLE:

Storm Sewer Profiles & Details

C07
07 OF 12
PROJECT NUMBER:
S04009-02